

SCAN MARINE/WALLAS Service Bulletin 070602

June 18, 2007




Re: Wallas 270 blower bearing re-alignment.


Symptom: Loud dragging or rattling noise when blower lid is activated.

The Wallas 270 blower end bushing sometimes gets pushed out of position during shipping & handling. This can be very quickly solved by following the instructions below:

1. Locate the blower end bushing located under the right rear side of the stove/blower assembly.

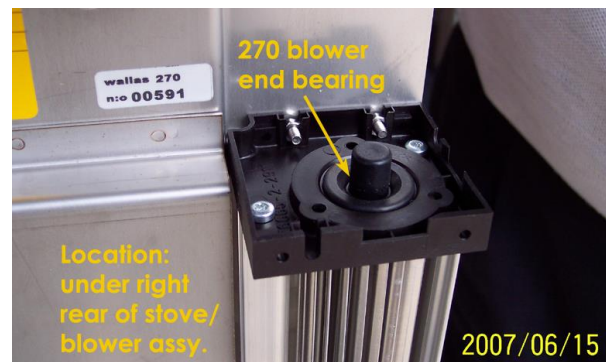

2. Remove the rubber end bearing carrier with thumb and forefinger by pulling on it.

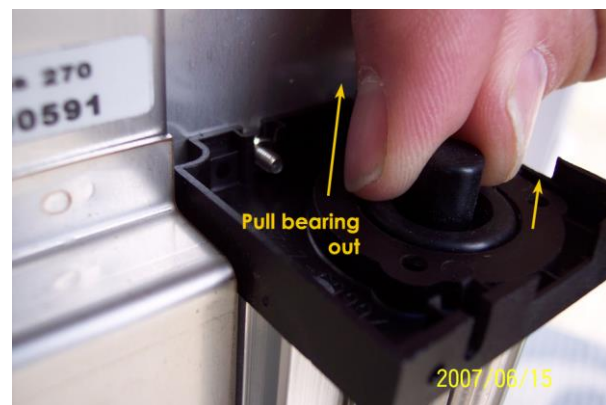

3. Re-install the bearing carrier, making sure the groove in the carrier fits evenly over the ridge in the blower housing.

